





# MGEHR/L

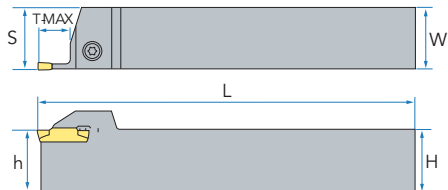

Обозначение	Размеры					Пластина	 Винт	 Ключ
	H=h	W	L	S	T-Max			
MGEHR/L1616-1.5	16	16	100	16,25	15	MG..150..	M5*16N	L4.0
MGEHR/L2020-1.5	20	20	125	20,25	15			
MGEHR/L1616-2	16	16	100	16,25	15	MG..200..		
MGEHR/L2020-2	20	20	125	20,25	15			
MGEHR/L2525-2	25	25	150	25,25	15	MG..250..		
MGEHR/L1616-2.5	16	16	100	16,35	17			
MGEHR/L2020-2.5	20	20	125	20,35	17	MG..300..		
MGEHR/L2525-2.5	25	25	150	25,35	17			
MGEHR/L1616-3	16	16	100	16,4	19	MG(R)..300..	M6*20N	L5.0
MGEHR/L2020-3	20	20	125	20,4	19			
MGEHR/L2020-3-T10	20	20	125	20,4	10			
MGEHR/L2525-3	25	25	150	25,4	19			
MGEHR/L2525-3-T10	25	25	150	25,4	10			
MGEHR/L3232-3	32	32	170	32,4	19	MG(R)..400..		
MGEHR/L2020-4	20	20	125	20,5	19			
MGEHR/L2020-4-T10	20	20	125	20,5	10,5			
MGEHR/L2525-4	25	25	150	25,5	19			
MGEHR/L2525-4-T10	25	25	150	25,5	10,5			
MGEHR/L3232-4	32	32	170	32,5	19	MG(R)..500..		
MGEHR/L2525-5	25	25	150	25,6	24			
MGEHR/L2525-5-T15	25	25	150	25,6	16			
MGEHR/L3232-5	32	32	170	32,6	24	MG(R)..600..		
MGEHR/L2020-6	20	20	125	20,6	23			
MGEHR/L2020-6-T15	20	20	125	20,6	15			
MGEHR/L2525-6	25	25	150	25,6	23			
MGEHR/L2525-6-T15	25	25	150	25,6	16			
MGEHR/L3232-6	32	32	170	32,6	23			

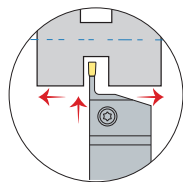